



Test Trench Log

Test Trench No.: TT-50-1501-9

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/60

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

Elev. (ft)	Depth (ft)	Sample	Rec. (ft)	PID (ppm)	Description	Profile	Remarks
0	0	T-50-1501-9 (0-1')		0.0	Sand, fine to medium, poorly sorted, loose, moist, orange, possible ash, some gravel		Topsoil
-2	2			0.0			
-4	4	T-50-1501-9 (1-6')		0.0	Silty sand, fine to medium, medium dense, moist, dark brown		
-6	6				End of Test Trench		
-8	8						Depth to top of footing 5'
-10	10						
-12	12						
-14	14						
-16	16						
-18	18						
-20	20						
-22	22						
-24	24						
-26	26						
-28	28						
-30	30						



Test Trench Log

Test Trench No.: TT-51-302A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

ev. (t)	Depth (ft)	Sample	Rec. (ft)	PID (ppm)	Description	Profile	Remarks
0	0	TT-51-302A (0-1')		0.0	Sand, fine to medium, poorly sorted, loose, dark brown		Topsoil
-2	2			0.0			Steam line support footing
-4	4	TT-51-302A (1-6')		0.0	Sand, medium to coarse, poorly sorted, loose, moist, brown		
-6	6				End of Test Trench		
-8	8						
-10	10						
-12	12						
-14	14						
-16	16						
-18	18						
-20	20						
-22	22						
-24	24						
-26	26						
-28	28						
-30	30						



Test Trench Log

Test Trench No.: TT-52-302A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 10

Depth to Water (ft): ---

Elev. (ft)	Depth (ft)	Sample	Rec. (ft)	PID (ppm)	Description	Profile	Remarks
0	0	TT-52-302A (0-1')		0.0	Sand, trace organics, poorly sorted, loose, moist, dark brown		Topsoil
-2	2	TT-52-302A (1-2')		0.0	Sand, medium to coarse, poorly sorted, loose, moist, brown		
		TT-52-302A (2-3')		0.0	Gravel		
-4	4						
-6	6	TT-52-302A (3-10')		0.0	Sand, medium to coarse, poorly sorted, loose, moist, brown		
-8	8						Horizontal clay pipe at 9'
-10	10				End of Test Trench		Orange and light brown staining around pipe
-12	12						
-14	14						
-16	16						
-18	18						
-20	20						
-22	22						
-24	24						
-26	26						
-28	28						
-30	30						



Test Trench Log

Test Trench No.: TT-53-305A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 4

Depth to Water (ft): ---

Elev. (ft)	Depth (ft)	Sample	Rec. (ft)	PID (ppm)	Description	Profile	Remarks
0	0	TT-53-305A (0-1')		0.0	Sand, fine to medium, poorly sorted, loose, moist, dark brown		Topsoil
-2	2	TT-53-305A (1-4')		0.0	Sand, medium to coarse, poorly sorted, loose, moist, brown		Horizontal clay pipe at 2'
-4	4			0.0	End of Test Trench		Depth to top of footing 3'
-6	6						
-8	8						
-10	10						
-12	12						
-14	14						
-16	16						
-18	18						
-20	20						
-22	22						
-24	24						
-26	26						
-28	28						
-30	30						



Test Trench Log

Test Trench No.: TT-54-722Y

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

Elev. (ft)	Depth (ft)	Sample	Rec. (ft)	PID (ppm)	Description	Profile	Remarks
0	0	TT-54-722Y (0-1')		0.0	Sand, fine to medium, poorly sorted, loose, dark brown		Topsoil
-2	2			0.0			
-4	4	TT-54-722Y (1-6')		0.0	Sand, medium to coarse, poorly sorted, loose, moist, brown		Near possible wood box dry well at 3.5'
-6	6				End of Test Trench		Depth to top of footing 4'
-8	8						
-10	10						
-12	12						
-14	14						
-16	16						
-18	18						
-20	20						
-22	22						
-24	24						
-26	26						
-28	28						
-30	30						



Test Trench Log

Test Trench No.: TT-55-302-A2

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/11/06

Date Completed: 9/11/06

Elevation (ft): 0

Total Depth (ft): 5

Depth to Water (ft): ---

Elev. (ft)	Depth (ft)	Sample	Rec. (ft)	PID (ppm)	Description	Profile	Remarks
0	0	T-55-302-A2 (0-1')		0.0	Sand, fine to medium, poorly sorted, loose, moist, dark brown		Topsoil
-2	2			0.0			
-4	4	T-55-302-A2 (1-5')		0.0	Sand, medium to coarse, poorly sorted, loose, moist, brown		Metal pipe at 3.5' Orange staining around pipe
-6	6				End of Test Trench		Depth to top of footing 4'
-8	8						
-10	10						
-12	12						
-14	14						
-16	16						
-18	18						
-20	20						
-22	22						
-24	24						
-26	26						
-28	28						
-30	30						



Test Trench Log

Test Trench No.: TT-56-303A

Project: UMore Park

Contractor/Crew: Veit Speciality

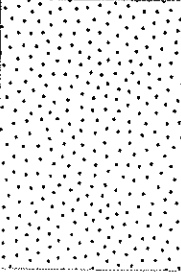
Date Started: 9/11/06

Date Completed: 9/11/06

Elevation (ft): 0

Total Depth (ft): 5

Depth to Water (ft): ---

Elev. (ft)	Depth (ft)	Sample	Rec. (ft)	PID (ppm)	Description	Profile	Remarks
0	0			0.0			Class V
-2	2	TT-56-303A (0-5')		0.0	Sand, some silt, medium to coarse, poorly sorted, loose, moist, gray with orange staining		
-4	4		0.0				
-6	6		0.0				
					End of Test Trench		
-8	8						Depth to top of awning 4.5'
-10	10						Depth to top of building 7'
-12	12						
-14	14						
-16	16						
-18	18						
-20	20						
-22	22						
-24	24						
-26	26						
-28	28						
-30	30						