



Test Trench Log

Test Trench No.: TT-21-202C

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 9

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|-------------------|-----------|-----------|--|---------|----------------------------------|
| 0 | 0 | | | 0.0 | | | Concrete footings in test trench |
| -2 | 2 | TT-21-202C (0-3') | | 0.0 | Sand, trace organics, fine to medium, poorly sorted, loose, moist, dark brown, roots to 2' | | |
| -4 | 4 | | | 0.0 | | | |
| -6 | 6 | TT-21-202C (3-9') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | End of Test Trench | | |
| -12 | 12 | | | | | | Depth to top of footing 9' |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-22-202C

Project: UMore Park

Contractor/Crew: Veit Speciality Date Started: 9/7/06 Date Completed: 9/7/06

Elevation (ft): 0 Total Depth (ft): 9 Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|-------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-22-202C (0-1') | | 0.0 | Sand, trace organics, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| -2 | 2 | TT-22-202C (1-3') | | 0.0 | Silty sand, fine to medium, poorly sorted, loose, moist, dark brown | | Near possible dry well |
| -4 | 4 | | | 0.0 | | | |
| -6 | 6 | TT-22-202C (3-9') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | End of Test Trench | | Depth to top of footing 8' |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-23-208C

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 5

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|-------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-23-208C (0-1') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| -2 | 2 | TT-23-208C (1-5') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | Depth to top of footing 3' |
| -4 | 4 | | 0.0 | | | | |
| -6 | 6 | | | | End of Test Trench | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-24-208C

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 13

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-24-208C (0-1') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| -2 | 2 | | | 0.0 | | | |
| -4 | 4 | | | 0.0 | | | Depth to top of footing 2' |
| -6 | 6 | | | 0.0 | | | |
| -8 | 8 | TT-24-208C (1-13') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | End of Test Trench | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | Near sanitary line |



Test Trench Log

Test Trench No.: TT-25-206B

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 11

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|--|
| 0 | 0 | TT-25-206B (0-1') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| -2 | 2 | | | 0.0 | | | Near possible dry well |
| -4 | 4 | | | 0.0 | | | Depth to top of footing 2' |
| -6 | 6 | TT-25-206B (1-11') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | End of Test Trench | | Depth to top of footing at corners 10' |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-26-263A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 5

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|-------------------|-----------|-----------|--|---------|--------------|
| 0 | 0 | TT-26-263A (0-1') | | 0.0 | Sand, some roots, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| | | TT-26-263A (1-2') | | 0.0 | Silty sand, some clay, fine to medium, poorly sorted, medium dense, moist, brown | | Strange odor |
| -2 | 2 | | | | | | |
| | | TT-26-263A (2-5') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -4 | 4 | | | | | | |
| | | | | | End of Test Trench | | |
| -6 | 6 | | | | | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-27-263A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 4

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|-------------------|-----------|------------|--|---------|-----------------------|
| 0 | 0 | TT-27-263A (0-1') | | 0.0 0.0 | Sand, some roots, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| -2 | 2 | TT-27-263A (1-4') | | 0.0 | Silty sand, some clay, very fine to medium, poorly sorted, loose, moist, brown | | Glass test tube piece |
| -4 | 4 | | | | End of Test Trench | | |
| -6 | 6 | | | | | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-28-226A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 11

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|--|---------|---|
| 0 | 0 | TT-28-226A (0-1') | | 0.0 | Sand, fine to medium, poorly sorted, organic, dark brown | | Topsoil Near vertical clay drain pipe, possible steam pipe support footing |
| -2 | 2 | | | 0.0 | | | |
| -4 | 4 | | | 0.0 | | | |
| -6 | 6 | TT-28-226A (1-11') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | Depth to top of footing 8' |
| -12 | 12 | | | | End of Test Trench | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-29-226A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 13

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|--|
| 0 | 0 | TT-29-226A (0-1') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil Near 3 horizontal steel pipes and 1 clay pipe |
| -2 | 2 | TT-29-226A (1-2') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| | | TT-29-226A (2-3') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, dark brown | | |
| -4 | 4 | | | | | | Depth to top of footing 4' |
| -6 | 6 | | | 0.0 | | | |
| -8 | 8 | TT-29-226A (3-13') | | | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | End of Test Trench | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| 30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-30-234H

Project: UMore Park

Contractor/Crew: Veit Speciality Date Started: 9/7/06 Date Completed: 9/7/06
 Elevation (ft): 0 Total Depth (ft): 10 Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|--|---------|--|
| 0 | 0 | TT-30-234H (0-2') | | 0.0 | Sand, fine to medium, poorly sorted, loose, dark brown, tar paper on surface | | Topsoil Possible steam line support footing |
| -2 | 2 | | 0.0 | | | | |
| -4 | 4 | | | 0.0 | | | |
| -6 | 6 | TT-30-234H (2-10') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | End of Test Trench | | |
| -12 | 12 | | | | | | Depth to top of footing 10' |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-31-207B

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 9

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|------------------------------|
| 0 | 0 | TT-31-207B (0-8") | | 0.0 | Sand, trace organics, fine to medium, poorly sorted, loose, moist, brown, roots to 2' | | Topsoil |
| -2 | 2 | TT-31-207B (8"-3') | | 0.0 | Silty sand, fine to medium, poorly sorted, loose, moist, brown | | |
| -4 | 4 | | | 0.0 | | | |
| -6 | 6 | TT-31-207B (3-9') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | End of Test Trench | | Depth to top of footing 6.5' |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-32-207B

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 3

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-32-207B (0'-8") | | 0.0 | Silty sand, fine to medium, poorly sorted, loose, organics, brown | | Topsoil |
| -2 | 2 | TT-32-207B (8'-3") | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -4 | 4 | | | | End of Test Trench | | |
| -6 | 6 | | | | | | Depth to top of footing 3' |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-33-251B

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|--------------------------------------|
| 0 | 0 | TT-33-251B (0'-6") | | 0.0 | Sand, trace organics, fine to medium, poorly sorted, loose, moist, brown, sand cemented together with black material 1" thick | | Topsoil |
| -2 | 2 | | | | | | Near clay pipe and possible dry well |
| -4 | 4 | TT-33-251B (6"-6') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -6 | 6 | | | | End of Test Trench | | |
| -8 | 8 | | | | | | Depth to top of footing 5' |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-34-251B

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 2

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-34-251B (0'-6") | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, brown, sand cemented together with black material 1" thick | | Near 2 possible dry wells |
| | | TT-34-251B (6"-2') | | 0.0 | | | |
| -2 | 2 | | | | Sand, fine to medium, poorly sorted, loose, moist, brown | | |
| | | | | | End of Test Trench | | |
| -4 | 4 | | | | | | |
| -6 | 6 | | | | | | |
| -8 | 8 | | | | | | Depth to top of footing 5' |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-35-251B

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|-------------------|-----------|-----------|---|---------|--|
| 0 | 0 | TT-35-251B (0-1') | | 0.0 | Sand, trace organics, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| -2 | 2 | | | 0.0 | | | |
| -4 | 4 | TT-35-251B (1-6') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, brown | | Found 12" horizontal clay pipe at 5' Rusty orange color around pipe |
| -6 | 6 | | | | End of Test Trench | | |
| -8 | 8 | | | | | | Depth to top of footing 5' |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-36-209A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 12

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|---------------------|-----------|-----------|--|---------|--|
| 0 | 0 | TT-36-209A (0-6") | | 0.0 | Sand, trace organics, fine to medium, loose, roots, dark brown | | Topsoil |
| -2 | 2 | | | 0.0 | | | Horizontal pipe from building sump at 4' |
| -4 | 4 | | | | | | |
| -6 | 6 | TT-36-209A (6"-12") | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | Depth to top of footing 5' |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | End of Test Trench | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-37-233A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-37-233A (0-6") | | 0.0 | Silty sand, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| -2 | 2 | TT-37-233A (6"-3') | | 0.0 | Silty sand, fine to medium, poorly sorted, loose, moist, brown | | Near possible dry well |
| -4 | 4 | TT-37-233A (3-6') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -6 | 6 | | | | End of Test Trench | | |
| -8 | 8 | | | | | | Depth to top of footing 5' |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-38-205A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 5

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-38-205A (0-6") | | 0.0 | Sand, organics, medium to coarse, poorly sorted, loose, moist, dark brown, some Class V | | Topsail |
| -2 | 2 | | | 0.0 | | | |
| -4 | 4 | TT-38-205A (6"-5') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | Depth to top of footing 2' |
| | | | | | End of Test Trench | | |
| -6 | 6 | | | | | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-39-205A

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 3

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-39-205A (0'-6") | | 0.0 | Sand, organics, medium to coarse, poorly sorted, loose, moist, dark brown, some Class V | | Topsoil |
| -2 | 2 | | | | | | |
| -4 | 4 | TT-39-205A (6"-5") | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | Depth to top of footing 2' |
| -6 | 6 | | | | End of Test Trench | | |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-40-214C-13

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|---------------------|-----------|-----------|--|---------|----------------------------|
| 0 | 0 | T-40-214C-13 (0-1') | | 0.0 | Sand, trace organics, fine to medium, loose, moist, dark brown | | Topsoil |
| -2 | 2 | | | | | | |
| -4 | 4 | T-40-214C-13 (1-6') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -6 | 6 | | | | End of Test Trench | | Depth to top of footing 4' |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-41-269B

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|-------------------|-----------|-----------|---|---------|----------------------------|
| 0 | 0 | TT-41-269B (0-1') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil, Class V |
| -2 | 2 | | | 0.0 | | | |
| -4 | 4 | TT-41-269B (1-6') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -6 | 6 | | | | End of Test Trench | | Depth to top of footing 3' |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-42-269B

Project: UMore Park

Contractor/Crew: Veit Speciality

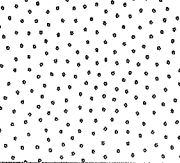
Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 3

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|-------------------|-----------|-----------|---|---|----------------------------|
| 0 | 0 | | | 0.0 | | | Topsoil, Class V |
| -2 | 2 | TT-42-269B (0-3') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, dark brown |  | |
| -4 | 4 | | | | End of Test Trench | | |
| -6 | 6 | | | | | | Depth to top of footing 3' |
| -8 | 8 | | | | | | |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-46-207AC

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/8/06

Date Completed: 9/8/06

Elevation (ft): 0

Total Depth (ft): 6

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|--|---------|----------------------------|
| 0 | 0 | TT-46-207AC (0-1') | | 0.0 | Sand, fine to medium, poorly sorted, loose, moist, dark brown | | Topsoil |
| -2 | 2 | TT-46-207AC (1-2') | | 0.0 | Silty sand, fine to medium, poorly sorted, medium dense, moist, dark brown | | Buried steel wound cables |
| -4 | 4 | TT-46-207AC (2-6') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| -6 | 6 | | | | End of Test Trench | | |
| -8 | 8 | | | | | | Depth to top of footing 5' |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |



Test Trench Log

Test Trench No.: TT-47-207AC

Project: UMore Park

Contractor/Crew: Veit Speciality

Date Started: 9/7/06

Date Completed: 9/7/06

Elevation (ft): 0

Total Depth (ft): 2

Depth to Water (ft): ---

| Elev. (ft) | Depth (ft) | Sample | Rec. (ft) | PID (ppm) | Description | Profile | Remarks |
|------------|------------|--------------------|-----------|-----------|---|---------|-------------------------------|
| 0 | 0 | TT-47-207AC (0-1') | | 0.0 | Silty sand, fine to medium, poorly sorted, medium dense, dark brown | | Topsoil |
| -2 | 2 | TT-47-207AC (1-2') | | 0.0 | Sand, medium to coarse, poorly sorted, loose, moist, brown | | |
| | | | | | End of Test Trench | | |
| -4 | 4 | | | | | | |
| -6 | 6 | | | | | | |
| -8 | 8 | | | | | | Depth to top of footing 5' |
| -10 | 10 | | | | | | |
| -12 | 12 | | | | | | |
| -14 | 14 | | | | | | |
| -16 | 16 | | | | | | |
| -18 | 18 | | | | | | |
| -20 | 20 | | | | | | |
| -22 | 22 | | | | | | |
| -24 | 24 | | | | | | |
| -26 | 26 | | | | | | |
| -28 | 28 | | | | | | |
| -30 | 30 | | | | | | |